



---

TECHNICAL NOTE No. 007-2006

11-Apr-2006

---

FAO Dealership Owner  
FAO Yr. Warranty Manager

**MODEL: SXV-RXV 450/550**

**Subject: Inspection of Magneto Flywheel to verify correct tightening torque**

Dear Dealer,

we have determined that the magneto flywheel nut on some engines has not been tightened to the correct torque.

**You are kindly required to inspect the vehicles in your inventory and the vehicles sold upon the next scheduled service following the procedure outlined below:**

- remove rotor
- check that the flywheel key is into place and in good condition (replace as required)
- degrease crankshaft and rotor tapers so as to remove any traces of oil
- refit all components and **tighten the flywheel nut to 100 N/m**

To obtain a refund, enter service repair operation code **AM009 BB 86** into A2D. If you have replaced the flywheel key, enter key part number in the same claim.

Best regards.

Piaggio & C. S.p.a.  
Aprilia Brand